| | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|----------------------------|-------|--|-------|----------------|
| S ¹ Time | Type: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |

Performance report for SiT9365 - 122.88 MHz, HCSL

Conditions:

- Frequency 122.88 MHz
- VDD: 2.5 V, 3.3 V
- Room temperature
- Termination:
 - $\circ~$ 30 Ω series and 50 Ω to GND.

Equipment:


| Model | Measurement / Purpose |
|------------------------------|--|
| Keysight DSA90604A (6 GHz, | Period jitter, differential voltage swing, rise/fall |
| 20 Gsps) | time, duty cycle |
| Keysight 5052B Signal Source | Phase noise, integrated phase jitter |
| Analyzer | |
| Keysight 34980A | Power supply current |
| Keysight E3631A | Power supply |
| Keysight 53230A | Frequency |


Test setup:

For waveform parameters measurement (rise/fall time, differential swing, duty cycle), both DUT outputs are terminated with 30 Ω series and 50 Ω to GND. Output signals are measured using Keysight 1134B active probe with Keysight N5425B probe head. All measurements are applied to the differential waveform. Figure 1 shows test setup diagram for waveform parameters measurement.

| 5451 Patrick Henry Drive, S | Santa Clara, California | a 95054 • 408.328.4400 | sitime.com |
|-----------------------------|-------------------------|------------------------|--------------------------------|
|-----------------------------|-------------------------|------------------------|--------------------------------|

| Si Time [®] | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|-----------------------------|-------|--|-------|----------------|
| | Type: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |

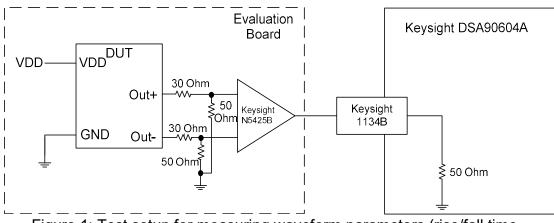

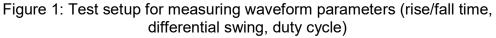

For period jitter measurement output is terminated with 30 Ω series and 50 Ω to GND at the input of hi-speed comparator (ADCMP581). AC coupled comparator's output is connected to oscilloscope channel. Figure 2 shows test setup diagram for period jitter measurement.

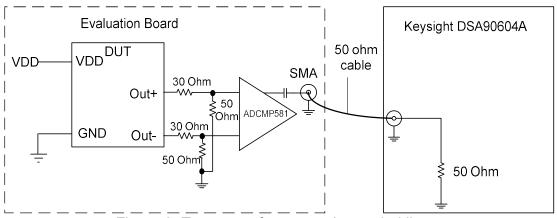


Figure 2: Test setup for measuring period jitter

For phase noise measurements, differential signal is converted to single-ended using impedance matching transformer. Transformer's output is connected to measurement instrument. Output is also terminated with 30 Ω series at the source side. Figure 3 shows test setup diagram for phase noise measurement.

| 5451 Patrick Henry Drive, Santa Clara, California 95054 • 408.328.4400 • sitime.com |
|---|
|---|

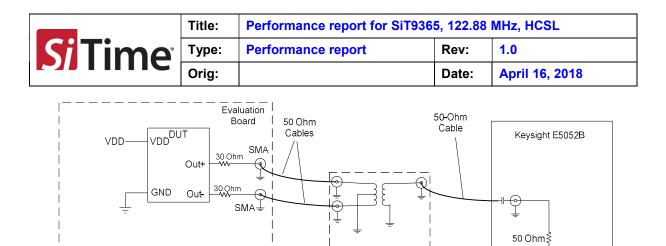


Figure 3: Test setup for measuring phase noise.

For IDD measurement device output is floating. For frequency measurement differential-to-single-ended converter is used.

Data:

- Phase noise
- Integrated phase jitter
- RMS period jitter
- Peak-to-peak period jitter
- Rise/fall time
- Duty cycle
- Differential output swing
- IDD
- Frequency stability over temperature

| Parameter | | Voltage | |
|--|---------|---------|-------|
| | | 2.5 V | 3.3 V |
| Integrated Phase jitter (1.875 MHz - 20 MHz) | fs, rms | 105 | 104 |
| Integrated Phase jitter (12 kHz - 20 MHz) | fs, rms | 226 | 225 |
| Period jitter | ps, rms | 0.97 | 0.96 |
| Period jitter (10,000 cycles) | | 7.46 | 7.37 |
| Duty cycle | % | 50.0 | 50.0 |
| Rise time (20% - 80%) | ps | 373 | 370 |
| Fall time (80% - 20%) | ps | 381 | 378 |
| Differential voltage swing | V | 1.42 | 1.48 |
| Current consumption (no load, output enabled) | mA | 76.2 | 76.9 |
| Current consumption (no load, output disabled) | mA | 50.8 | 51.2 |

Table 1: Summary performance data

| 5451 Patrick Henry Drive, Santa Clara, California 95054 | • 408.328.4400 • sitime.com |
|---|-----------------------------|
|---|-----------------------------|

| Si Time [®] | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|-----------------------------|-------|--|-------|----------------|
| | Туре: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |

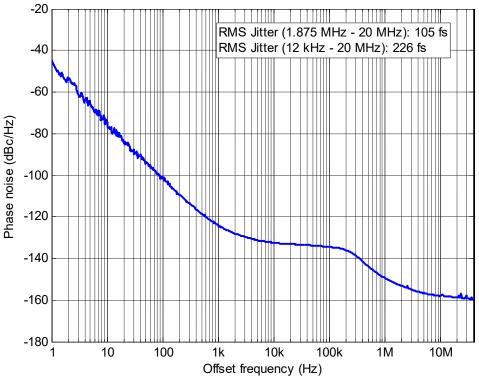


Figure 4: Phase noise, 2.5 V

| 5451 Patrick Henry Drive, Santa Clara, California 95054 | • 408.328.4400 • sitime.com |
|---|-----------------------------|
|---|-----------------------------|

| Si Time [®] | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|-----------------------------|-------|--|-------|----------------|
| | Туре: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |

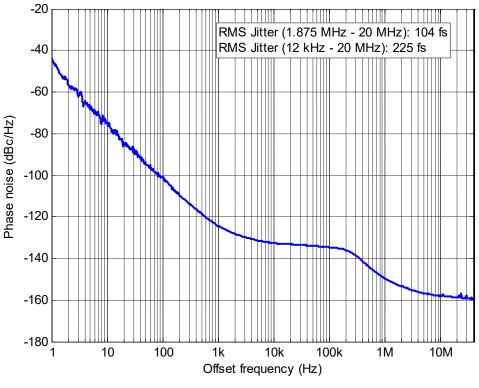


Figure 5: Phase noise, 3.3 V

| 5451 Patrick Henry Drive, Santa Clara, California 95054 | • 408.328.4400 • sitime.com |
|---|-----------------------------|
|---|-----------------------------|

| Si Time [®] | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|-----------------------------|-------|--|-------|----------------|
| | Туре: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |



Figure 6: Output waveform, 2.5 V


| 5451 Patrick Henry Drive, Santa Clara, California 95054 • 408. | 328.4400 • sitime.com |
|--|-----------------------|
|--|-----------------------|


| | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|--|-------|--|-------|----------------|
| | Туре: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |



Figure 7: Output waveform, 3.3 V

| | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|----------------|-------|--|-------|----------------|
| Si Time | Type: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |

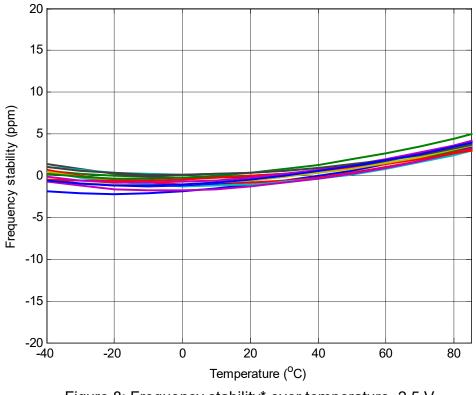

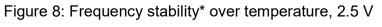

*SiT9365 frequency stability is independent of output frequency.

| 5451 Patrick Henry Drive, Santa Clara, California 95054 | 408.328.4400 sitime.com |
|---|--|
|---|--|

| | | Performance report for SiT9365, 122.88 MHz, HCSL | | |
|----------------|-------|--|-------|----------------|
| Si Time | Type: | Performance report | Rev: | 1.0 |
| | Orig: | | Date: | April 16, 2018 |

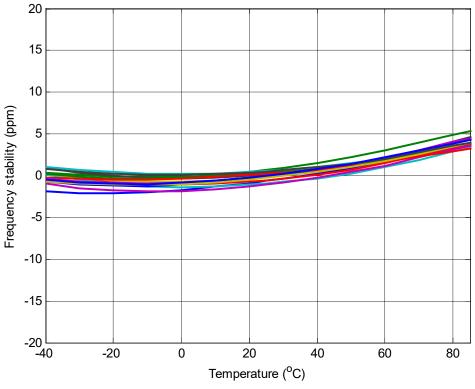


Figure 9: Frequency stability over temperature, 3.3 V

| 5451 Patrick Henry Drive, Santa Clara, California 95054 • 408.328.4400 • siti | me.com |
|---|--------|
|---|--------|